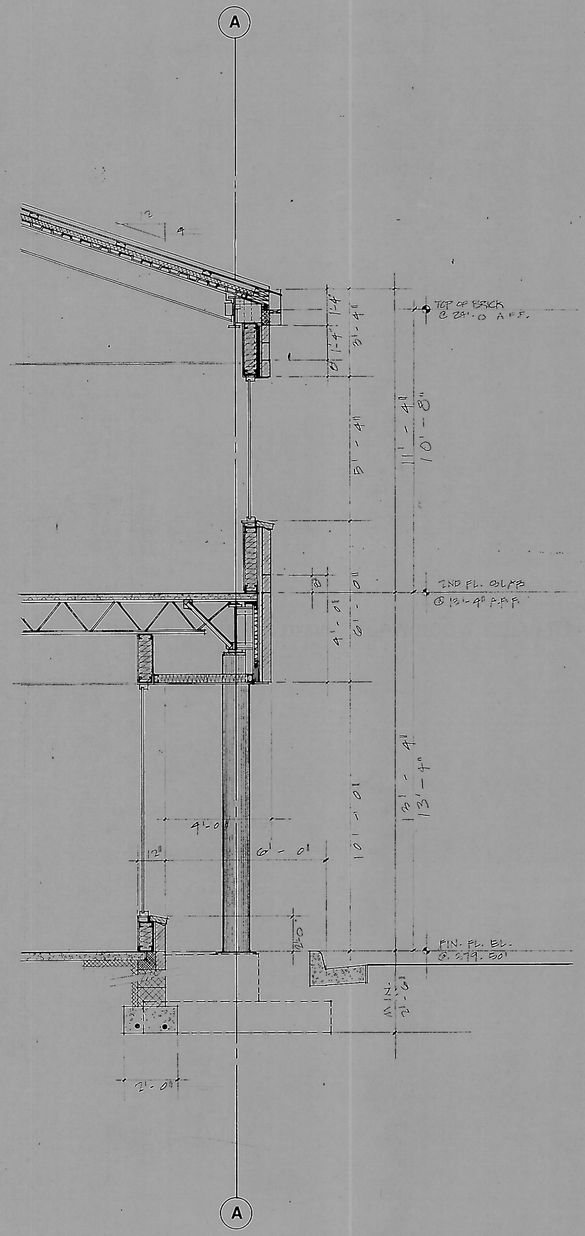

5 Wall Section
3/8" = 1'-0"

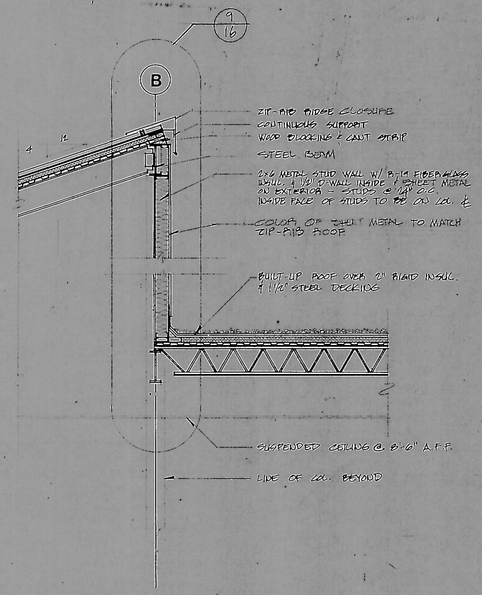

7 Wall Section
3/8" = 1'-0"

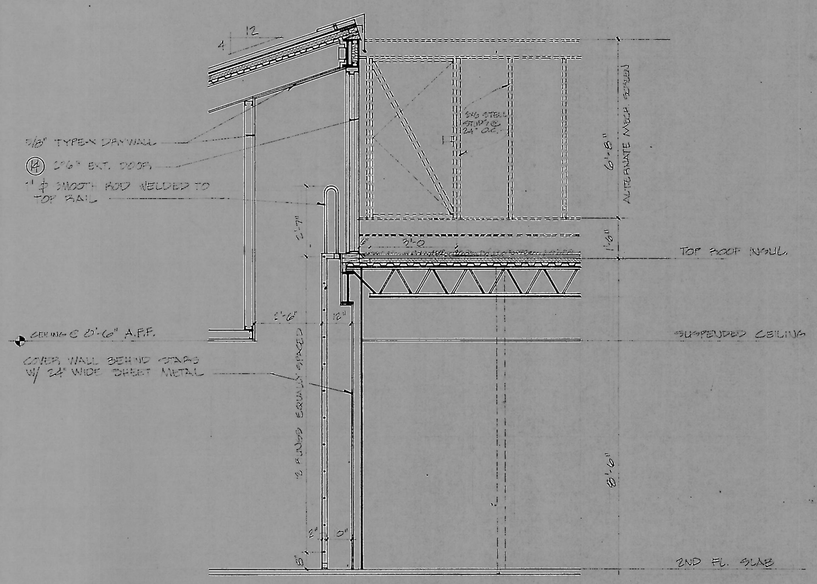

8 Wall Section at Roof Access
3/8" = 1'-0"

FINISHING SCHEDULE

ROOM	FLOOR	WALLS	BASE	CEILING	REMARKS
1st Floor					
Bldg. Lobby	Quarry Tile 6 x 6	Brick (Rustique) Storefront	None	Drywall	-
ATM Lobby	Quarry Tile 6 x 6	Brick (Rustique) Drywall	Quarry Tile	Suspended 2 x 4	-
ATM Stor.	V.A.T.	Drywall	Vinyl	Suspended 2 x 4	
Bank Rest. Rm.	Ceramic Tile 4 x 4	Drywall	Ceramic Tile	Suspended 2 x 4	Drywall to be water board behind sink
Lounge/Storage	V.A.T. 9 x 9	Drywall	Vinyl	Suspended 2 x 4	
Conference Room	Carpet	Drywall	Vinyl	Suspended 2 x 4	
Office 1	Carpet	Drywall	Vinyl	Suspended 2 x 4	
Office 2	Carpet	Drywall	Vinyl	Suspended 2 x 4	
Manager's office	Carpet	Drywall	Vinyl	Suspended 2 x 4	
Platform	Carpet	Drywall	Vinyl	Suspended 2 x 4	
Branch Bank Lobby	Carpet	Drywall	Vinyl	Suspended 2 x 4	-
Teller Area	V.A.T.	Drywall	Vinyl	Suspended 2 x 4	-
Coupon Booths	Carpet	Drywall	Vinyl	Suspended 2 x 4	-
Vault	Carpet	Concrete	Vinyl	Concrete	-
Elec. Equip. Rm.	Concrete	Drywall	Vinyl	Suspended 2 x 4	-
Elev. Equip. Rm.	Concrete	Drywall	Vinyl	Suspended 2 x 4	-
Men	Ceramic Tile 4 x 4	Ceramic Tile 2 x 2 and Drywall	Ceramic Tile	Suspended 2 x 4	Drywall to be water board behind sinks
Women	Ceramic Tile 4 x 4	Ceramic Tile 2x2 and drywall	Ceramic Tile	Suspended 2 x 4	Drywall to be water board behind sinks
Stair Tower	Concrete	Concrete Block	Vinyl	Drywall	Walls Painted
Corridor 1B*	Concrete	Drywall	Vinyl	Suspended 2 x 4*	
Tenant Space	Concrete	Drywall	Vinyl	Suspended 2 x 4*	
Elevator	Quarry Tile 6 x 6	Vertical Plastic laminate Panels	-	Suspended Alum. frame w/ lumasite Diffuser	-
Second Floor					
Jan. Clos	Ceramic Tile 4x4	Drywall	Vinyl	Drywall	*Water board behind Sink *Galv. sheet metal behind ladder
Men	Ceramic 4 x 4	Ceramic Tile 2 x 2	Ceramic Tile	Suspended 2 x 4	Drywall to be water board behind sinks
Women	Ceramic 4 x 4	Ceramic Tile	Ceramic Tile	Suspended 2 x 4	Drywall to be water board behind sinks
Mech. Chase 1	Fire Damper	1 hr. drywall	-	-	-
Mech. Chase 2	Fire Damper	1 hr. drywall	-	-	-
Lobby	Quarry Tile 6 x 6	Brick (Rustique) Storefront (See drawings)	Quarry Tild	Drywall	-

* Tenant Improvement

LD LR

REVISIONS

DATE
SCALE
DRAWN
CHECKED

WALL SECTIONS, FINISH SCHEDULE

FIRST NATIONAL BANK BUILDING
OWNER: FIRST NATIONAL BANK OF MARYLAND
ARCHITECT: LAND DESIGN/RESEARCH

10